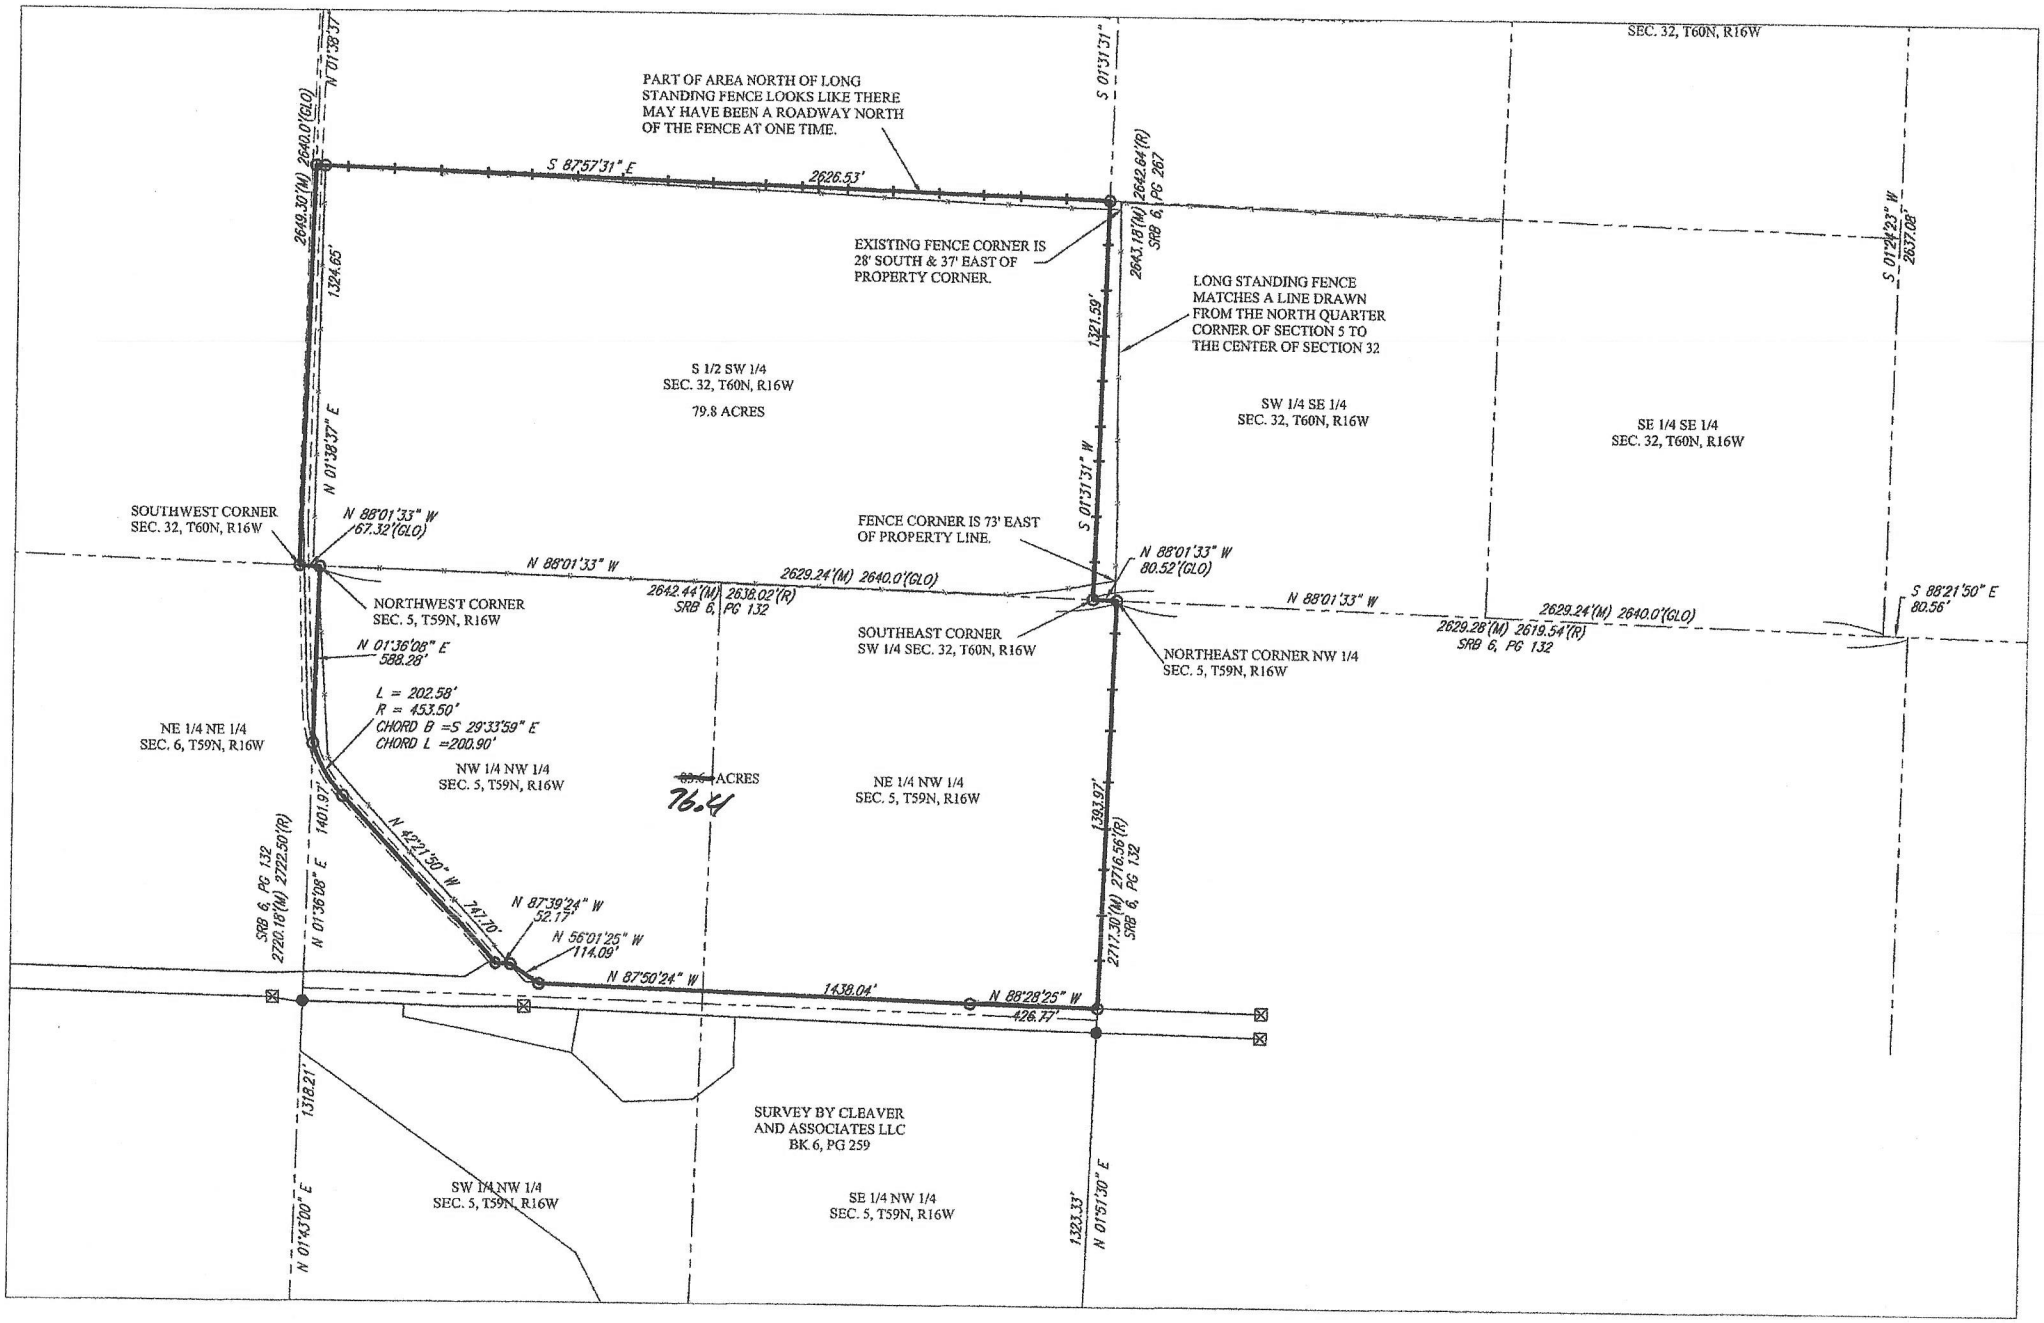
SEC. 32, T60N, R16W
PART OF AREA NORTH OF LONG STANDING FENCE LOOKS LIKE THERE MAY HAVE BEEN A ROADWAY NORTH OF THE FENCE AT ONE TIME.
S 87°57'31" E
2626.53'
S 01°31'31" E
2642.64'(R) SRB 6, PG 267
EXISTING FENCE CORNER IS 28' SOUTH & 37' EAST OF PROPERTY CORNER.
2643.18'(M)
SRB 6, PG 132
LONG STANDING FENCE MATCHES A LINE DRAWN FROM THE NORTH QUARTER CORNER OF SECTION 5 TO THE CENTER OF SECTION 32
S 01°24'23" W
2637.08'
N 01°38'37" E
2649.30'(M) 2640.0'(GLO)
1324.65'
1321.59'
S 1/2 SW 1/4
SEC. 32, T60N, R16W
79.8 ACRES
SW 1/4 SE 1/4
SEC. 32, T60N, R16W
SE 1/4 SE 1/4
SEC. 32, T60N, R16W
S 01°31'31" W
SOUTHWEST CORNER
SEC. 32, T60N, R16W
N 88°01'33" W
67.32'(GLO)
FENCE CORNER IS 73' EAST OF PROPERTY LINE.
N 88°01'33" W
80.52'(GLO)
N 88°01'33" W
2629.24'(M) 2640.0'(GLO)
2642.44'(M) 2638.02'(R)
SRB 6, PG 132
S 88°21'50" E
80.56'
NORTHWEST CORNER
SEC. 5, T59N, R16W
N 88°01'33" W
2629.24'(M) 2640.0'(GLO)
2629.26'(M) 2619.54'(R)
SRB 6, PG 132
SOUTHEAST CORNER
SW 1/4 SEC. 32, T60N, R16W
NORTHEAST CORNER NW 1/4
SEC. 5, T59N, R16W
N 01°36'08" E
588.26'
L = 202.58'
R = 453.50'
CHORD B =S 29°33'59" E
CHORD L =200.90'
NE 1/4 NE 1/4
SEC. 6, T59N, R16W
NW 1/4 NW 1/4
SEC. 5, T59N, R16W
~~83.6~~ ACRES
76.4
NE 1/4 NW 1/4
SEC. 5, T59N, R16W
1393.97'
SRB 6, PG 132
2722.50'(R)
2720.16'(M)
N 01°36'08" E
1401.97'
N 42°21'50" W
747.70'
N 87°39'24" W
52.17'
N 56°01'25" W
114.09'
2716.56'(R)
SRB 6, PG 132
2717.30'(M)
N 87°50'24" W
1438.04'
N 88°28'25" W
426.77'
1318.21'
N 01°43'00" E
SURVEY BY CLEAVER AND ASSOCIATES LLC
BK 6, PG 259
SW 1/4 NW 1/4
SEC. 5, T59N, R16W
SE 1/4 NW 1/4
SEC. 5, T59N, R16W
1323.33'
N 01°51'30" E